Property of the second second

26 Ser 69 22 232

S E C R E T 262210Z SEP 69/CITE 7109/

OUT 68469

25X1

25X1

1. WILL DO UTMOST TO SEND DILOCONE FLUID ON VICTEX 30 SEPT. IF UNSUCCESSFUL WILL CABLE YOU SPECIFICATIONS, TRADE-NAME AND EQUIVALENT IF KNOWN.

25X1

2. AS NO DETAILS OF PROBLEM WERE GIVEN HAVE ASSUMED YOU ARE EXPERIENCING DIFFICULTY IN GETTING THE TENSION ARMS AND OFFER FOLLOWING SUGGESTIONS:

(A) TRY COUNTERWEIGHT CABLE LINKS SET IN DIFFERENT HOLES ON TENSION ARMS.

(B) LEAVE ABOUT ONE INCH AIR SPACE IN TOP OF DASHPOTS WHEN

REFILLING.

END OF MESSAGE

(C) COMMON CAUSE OF THIS TROUBLE LIES IN THE ELECTRIC CONTROL CONSOLE. REMOVE LEFT HAND SIDE PANEL OF CONSOLE. NEAR BOTTOM ARE TWO TUBES (THERMIONIC VALVES) AND ADJACENT TO EACH IS A POTENTIO-METER ADJUSTABLE WITH A SCREWDRIVER. EACH TUBE AND POTENTIOMETER IS ASSOCIATED WITH ONE TENSION ARM AND ROTATION OF POTENTIOMETER WILL ADJUST POSITION OF TENSION ARM. IF THIS HAS ONLY LIMITED EFFECT THEN TUBE IS PROBABLY FAULTY AND SHOULD BE CHANGED. SECRET

